

Link do produktu: <https://www.czescimakita.com/zlaczka-weza-makita-413490-2-459223-1-p-456019.html>



złączka węża Makita 413490-2 (459223-1)

Cena brutto	23,87 zł
Cena netto	19,41 zł
Dostępność	Zazwyczaj do 5 dni roboczych po złożeniu i opłaceniu zamówienia
Czas wysyłki	W ciągu 24 godzin od pełnego skompletowania zamówienia
Kod producenta	413490-2
Producent	Makita Corporation

Opis produktu

złączka węża 413490-2 Makita (nowy numer 459223-1) do DSL800

Złączka 459223-1 nie jest współzamienna z nową złączką 413490-2

Technical Information


DC179

1 Outline


Title	Change of Arm set, Joint, Hose connector, Dust nozzle Elimination of O ring 20, O ring 23 Addition of Rivet 7
Model	DSL800, XLS01
Country	All countries
Description	To improve the dust collecting efficiency; • Arm set, Joint, Hose connector and Dust nozzle will be changed. • O ring 20 and O ring 23 will be eliminated. • Rivet 7 will be added.

2 Detailed information

[1] Arm set (183L76-5)

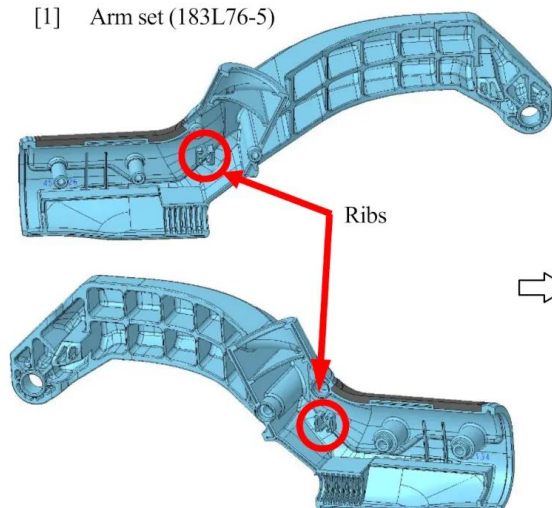


Arm set (183T15-3)

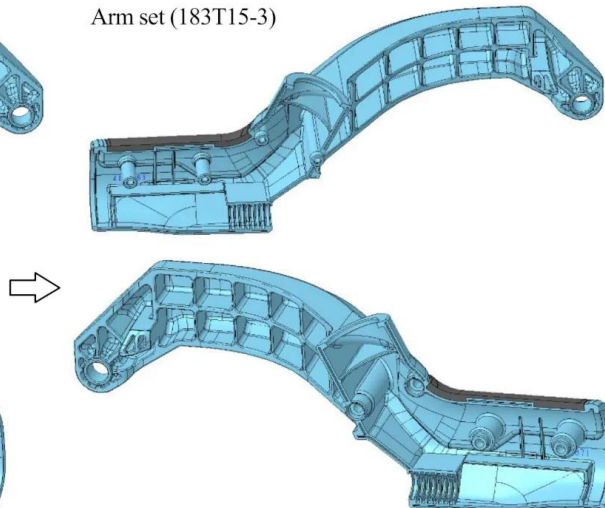


[2] Joint (459222-3)




Joint (422617-3)

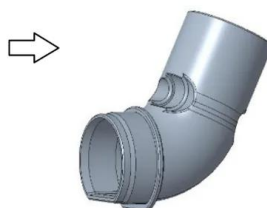

[3] Hose connector (459223-1)

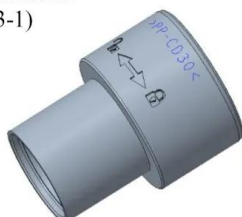


Hose connector (413490-2)

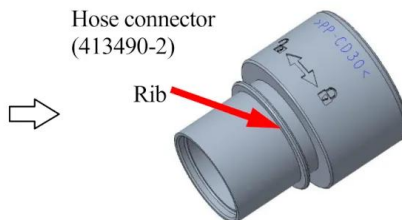


- [4] Elimination of O ring 20 attached to the current Joint
- [5] Elimination of O ring 23 attached to the current Joint


[6] Dust nozzle (459234-6)

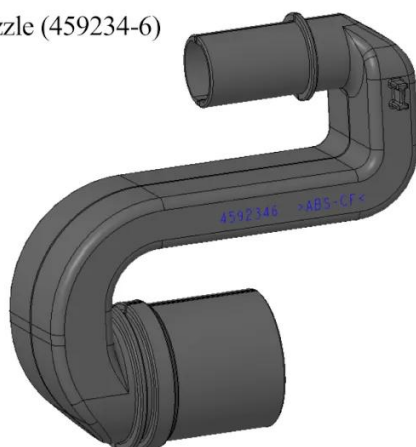

Dust nozzle assy (127672-7)

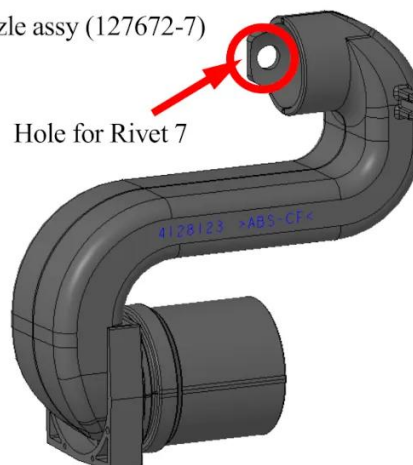


[7] Addition of Rivet 7 (412987-8)

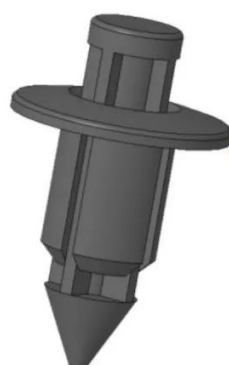

Pipe B complete

Insert Pipe B complete into Dust nozzle assy, then fasten them with Rivet 7 (412987-8).

Dust nozzle assy

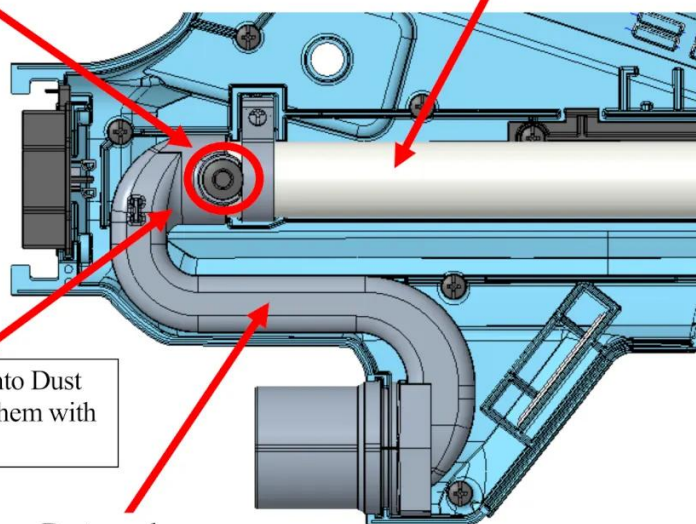

3 Parts information

	Item No.	Current part	Q'ty	I/C	H/S	S/P	New part	Q'ty	Note
[1]	052 057	ARM SET 183L76-5	1	S	OK	A	ARM SET 183T15-3	1	Interchangeable as a set
[2]	049	JOINT 459222-3	1	S	OK	A	JOINT 422617-3	1	
[3]	047	HOSE CONNECTOR 459223-1	1	S	OK	A	HOSE CONNECTOR 413490-2	1	
[4]	048	O RING 20 213304-3	1	S	OK	L			
[5]	050	O RING 23 213393-8	1	S	OK	L			
[6]	075	DUST NOZZLE 459234-6	1	S	OK	A	DUST NOZZLE ASSY 127672-7	1	Interchangeable as a set
[7]	095						RIVET 7 412987-8	1	

3-1 Marks of Interchangeability (I/C), Handling (H/S), Supplying (S/P)

I/C (Interchangeability)	Yes	The new part can be substituted for the current and the current part can be substituted for the new.
	No	The new part cannot be substituted for the current and the current part cannot be substituted for the new.
	←	The new part can be substituted for the current.
	→	The current part can be substituted for the new.
	S	Interchangeable as a set.
H/S (Handling for plants, agents, and distributors stock of the current parts)	OK	The current parts can be used for the subject item No(s). of the subject model(s).
	NOK	The current parts cannot be used for the subject item No(s). of the subject model(s), but can be used for the other item No(s) or the other models.
	T	The current parts in stock must be thrown away due to the technical reason.
S/P (Supplying the current parts for repair from plants)	L	The plants stop supplying the current parts under the above conditions [Model(s), Countries, Item No(s).]. However, they can supply the current parts under other conditions.
	D	The plants stop supplying the current parts.
	C	The plants continue to supply the current parts.
	Z	The plants continue supplying only for a certain period or amount.
	A	After the current parts in plant stock are cleared, they will be discontinued.

4 Implementation

After the current parts in stock are cleared.

SCHEMAT

4219-47,

